




**Model EPP-30V** 

#### INTRODUCTION

The piezometer, also known as pore pressure meter, is used to measure pore water pressure in soil, earth/rock fills, foundations and concrete structures. It provides significant quantitative data on the magnitude and distribution of pore pressure and its variations with time. It also helps in evaluating the pattern of seepage, zones of potential piping and the effectiveness of seepage control measures undertaken.

Proper evaluation of pore pressure helps in monitoring the behavior after construction and indicates potentially dangerous conditions that may adversely affect the stability of the structure, its foundation and appurtenant. It also provides basic data for design improvement that will promote safer and more economical design and construction.

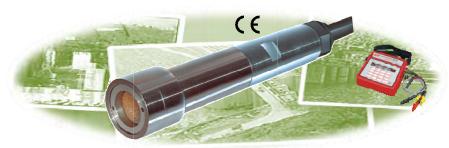

# **APPLICATIONS**

- determine the flow pattern through earth/rock fill and concrete dams and their foundations and to delineate the phreatic line.
- Measuring the elevation of ground water in stand pipes, bore holes and wells.
- Hydrological investigation, construction control, stability investigation and monitoring of earth dams, foundations, shallow underground works surface excavations.
- Monitoring & control of dewatering & drainage.

# **OVERVIEW**

The Encardio-rite piezometer incorporates the latest vibrating wire technology to provide remote digital readout of fluid and/or water pressure in standpipes, boreholes, embankments, fully and partially saturated natural soils, rolled earth fills and the interface of retaining structures. The superiority of Encardio-rite diaphragm type piezometers for these measurements is unquestionable.

## **OPERATING PRINCIPLE**

Encardio-rite pore pressure meter basically consists of a magnetic, high tensile strength stretched wire, one end of which is anchored and the other end fixed to a diaphragm which deflects in some proportion to the applied pressure. Any deflection of the diaphragm changes the tension in the wire, thus affecting the resonant frequency of the vibrating wire.

The resonant frequency with which the wire vibrates can be accurately measured. Encardio-rite model EDI-51V VW readout logger or ESCL-10VT single channel data logger or EDAS-10 data acquisition system are available for monitoring pore pressure at site.

- Protected against lightning spikes.

and simple to read.

Reliable, accurate, low cost

**FEATURES** 

- Easy installation in pressure standpipes, vessels and ideal underground work.
- Hermetically sealed under a vacuum of 0.001 Torr; stainless steel construction.
- Thermistor provided additional temperature measurement.
- Can measure negative pressure. Not limited to depth of water being within 5 m from the observation station as is in case of twin tube piezometers.
- Very small time lag.
- Transmission of signal as a frequency over long cable lengths.

### **DESCRIPTION OF EQUIPMENT**

Long term stability is ensured in the model EPP-30V Encardio-rite pore pressure meter by:

- Pressure and thermal cycling
- Unique method of wire clamping
- By generating a vacuum of around 1/1000 Torr inside the sensor by electron beam welding. This results in effect of oxidation, moisture, environmental conditions and any ingress of water being completely eliminated.

The pore pressure meter is individually temperature compensated making the requirement of a thermistor for temperature correction redundant. However a thermistor is provided for monitoring temperature.

### EPP-30V/1 Stainless steel sensor

The vibrating wire and coil magnet assembly is enclosed in corrosion resistant stainless steel body which is electron beam welded to the diaphragm.

## **EPP-30V/2 Metallic/ Ceramic filter**

A low air entry value ceramic filter of 40 micron porosity is provided. A locking nut holds the filter in position through a suitable 'O' ring. Other type of filters are available as an option.

## **ORDERING INFORMATION**

Model: EPP-30V-X (Range)-X

(Cable Housing for cable dia. 3.5- 8 mm or 9- 14 mm)

## EPP-30V/3 Cable joint housing

Leads from the coil magnet are terminated on a glass to metal seal which is electron beam welded to the stainless steel body of the pore pressure meter. Two pins marked red and black are connected to the coil magnet. A cable joint housing and suitable cable gland is provided for the cable connection.

### **SPECIFICATIONS**

Туре	Vibrating wire
Range (MPa)	0.2, 0.35, 0.5, 0.7, 1.0, 1.5, 2.0, 3.5, 5.0, 10.0, specify
Accuracy	± 0.25 % fs normal
	± 0.1 % fs optional
Non linearity	± 0.5 % fs
Temperature limit	
Operational	-20 to 80°C
Compensated	0 to 80°C
Insulation resistance	Better than 500 M Ohm at 12 V
Over range limit	150 % of range
Thermistor	YSI 44005 or equivalent

<sup>\*</sup>All specifications subject to change without prior notice.

